



SERVICE BULLETIN 43T-06-123-01

Contact: Mike Hankins, Director of Customer Relations
Mainship Corporation
mhankins@mainship.com

August 31, 2006

Model(s) Affected: 43 Trawler, Hulls ST101 – ST116

Bulletin Subject: Amp Meter Enhancement

Authorized Labor Time: .50 hour

All boats in the affected serial number range should have corrections made.

It has come to our attention that the amp meters on the above listed hull numbers may show abnormal readings at times. In order to correct this situation we have sent out (2) Current transformers per boat that need to be installed into the system to insure that the amp meters are reading correctly.

Any questions should be directed toward MAINSHIP Customer Service representatives.

Mike Hankins
(912) 880-2116
(800) 578-0852

Safety: Safety Glasses

Step 2: Rewire LEG 1/LEG 2 Selector Switch CTs.

1A. Remove the AC/DC Meter Panel.

1B. Locate the LEG 1/LEG 2 Selector Switch and remove the existing CT connections on pins 2,9,1,8 and 6,7.

1C. Rewire Selector Switch according to figure 3.

1D. replace AC/DC Meter Panel.



Figure 2 AC/DC Meter Panel

Safety: Safety Glasses

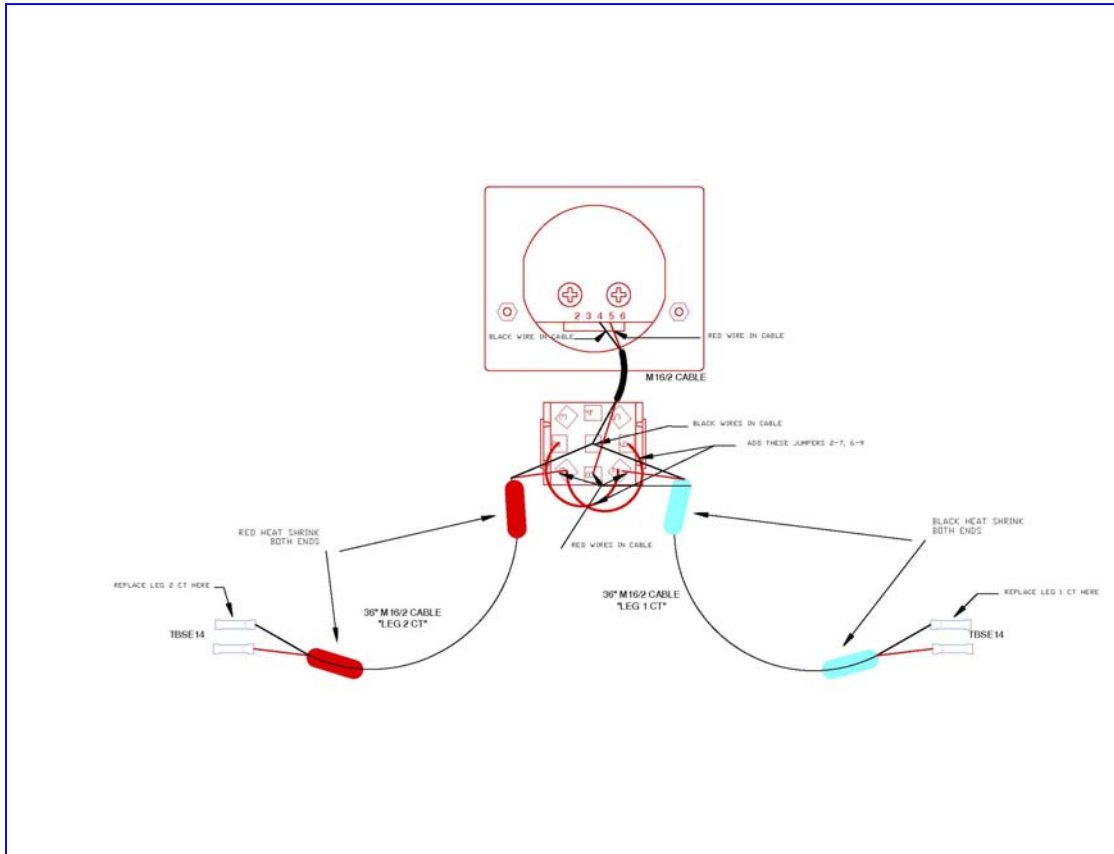


Figure 3 Selector Switch Wiring

